

Toyota U660E/F, U760E/F

sonnax®

TIME TESTED • INDUSTRY TRUSTED®

1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com

Click on Sonnax part numbers to see more information.

1 47740-06K Lockup Control Boost Valve Kit

Helps cure:

- TCC apply & release concerns
- TCC slip codes

2 47740-02K Oversized Primary Pressure Regulator & Reverse Boost Valve Kit

Helps cure:

- Poor line rise
- Clutch/Brake slippage

Note: Requires tool kit F-47740-TL2 & the VB-FIX reaming fixture.

3 47740-17K U660E/F Only 47740-38K U760E/F Only Reverse Boost Valve Kits

Helps cure:

- Low line rise in Reverse
- Delayed Reverse engagement

4 47740-24K U660E/F Only 47740-25K U760E/F Only Oversized Solenoid Modulator Valve Kits

Helps cure:

- Shift quality concerns
- Solenoid codes

Note: Both 47740-24K and 47740-25K require tool kit F-47740-TL24 the VB-FIX reaming fixture.

5 47740-30K U660E/F Only 47740-31K U760E/F Only Oversized Lockup Control Valve Kits

Helps cure:

- Harsh 2-3
- Harsh coast downshifts

Note: Both 47740-30K and 47740-31K require tool kit F-47740-TL30 the VB-FIX reaming fixture.

6 47740-11K B1, B2, B3, C2 Accumulator Piston Kit Fits any of 4 Locations

Helps cure:

- Harsh/Delayed shifts
- Delayed Reverse with harsh engagement

7 47740-12K C1 Accumulator Piston Kit


Helps cure:

- Harsh/Delayed forward engagement
- Burned C1 clutch

8 47740-19K U660E/F Only 47740-40K U760E/F Only B1 Apply Boost Valve Kits

Helps cure:

- 2nd & 6th Gear shift complaints
- B1 Brake clutches burnt

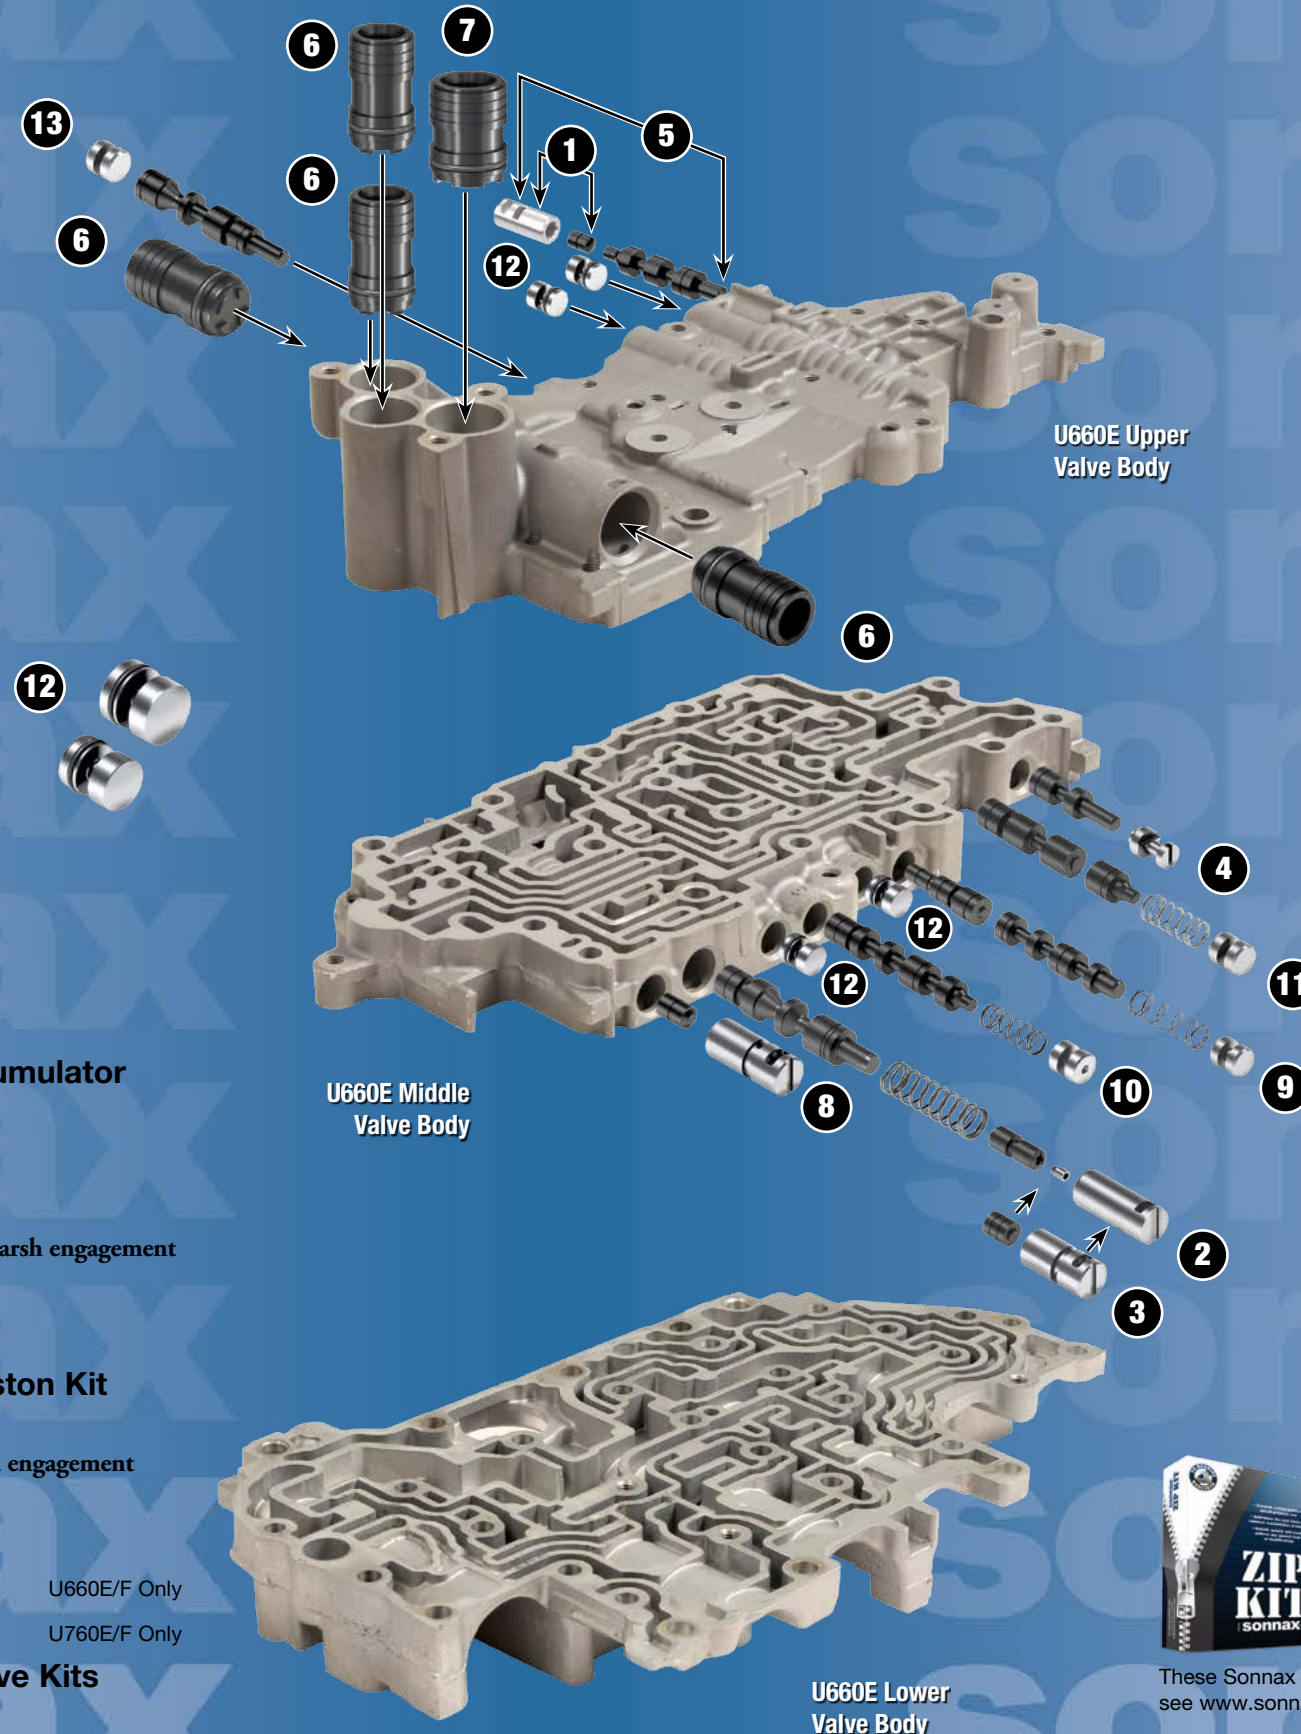

Zip Kit™
U660E-ZIP
Zip Kit™
U760E-ZIP

These Sonnax kits are also available, see www.sonnax.com for details.

9 47740-27K Oversized B2 Apply Control Valve Kit

Helps cure:

- Delayed, slipping or no Reverse
- B2 Clutch burned

Note: Requires tool kit F-47740-TL27 & the VB-FIX reaming fixture.

10 47740-22K Oversized Clutch Control Valve Kit

Helps cure:

- Harsh/Flared 4-5 or 5-4 shifts
- Delayed Reverse

Note: Requires tool kit F-47740-TL22 & the VB-FIX reaming fixture.

11 47740-35K Oversized B2 Control Valve Kit

Helps cure:

- Delayed/Harsh/Double bump Reverse engagement
- No manual 1st

Note: Requires tool kit F-47740-TL35 & the VB-FIX reaming fixture.

12 47740-21K O-Ringed End Plug Kit

Helps cure:

- Various shift concerns
- Burnt clutches

Note: Includes seven end plugs in various sizes. Follow usage chart on website or in packaging to determine correct location and size correlation.

13 47740-26K Oversized Secondary Pressure Regulator Valve Kit

Helps cure:

- Transmission overheating
- Bushing, bearing & other lube related failures

Note: Requires tool kit F-47740-TL26 & the VB-FIX reaming fixture.

©2015 Sonnax Industries, Inc.

The Sonnax products listed here may be protected by one or more patents, or be patent pending.