

# Toyota A760E/F/H Series\*

\*Also fits Toyota A761E, A960E/F & AB60E/F.

# sonnax®

TIME TESTED • INDUSTRY TRUSTED®

1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA  
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com


Click on Sonnax part numbers  
to see more information.

## 1 147741-07K Oversized Lockup Relay Valve Kit

Helps cure:

- Converter apply/release complaints & codes
- Burnt converters

Note: Requires tool kit F-147741-TL7 & the VB-FIX reaming fixture.

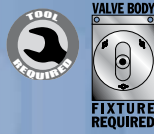


## 2 147741-10K Oversized Secondary Pressure Regulator Valve Kit

Helps cure:

- Converter apply/release complaints & codes
- Burnt converters

Note: Requires tool kit F-147741-TL4 & the VB-FIX reaming fixture.

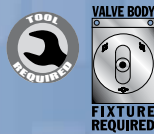

## 3 147741-01K Boost Valve Kit

Helps cure:


- Insufficient line rise in drive ranges
- Higher-than-normal reverse pressures

## 4 147741-04K Oversized Main Pressure Regulator & Boost Valve Kit

Helps cure:

- Low/High line pressure
- Soft and/or harsh shifts

Note: Requires tool kit F-147741-TL4 & the VB-FIX reaming fixture.

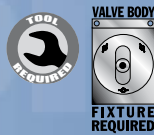

## 5 147741-30K O-Ringed End Plug Kit

Helps cure:



- Various complaints of leaking end plug
- Complaints relating to pressure loss

## 6 147741-05K Oversized Solenoid Modulator Valve Kit

Helps cure:

- Solenoid codes
- Shift complaints

Note: Requires tool kit F-147741-TL5 & the VB-FIX reaming fixture.

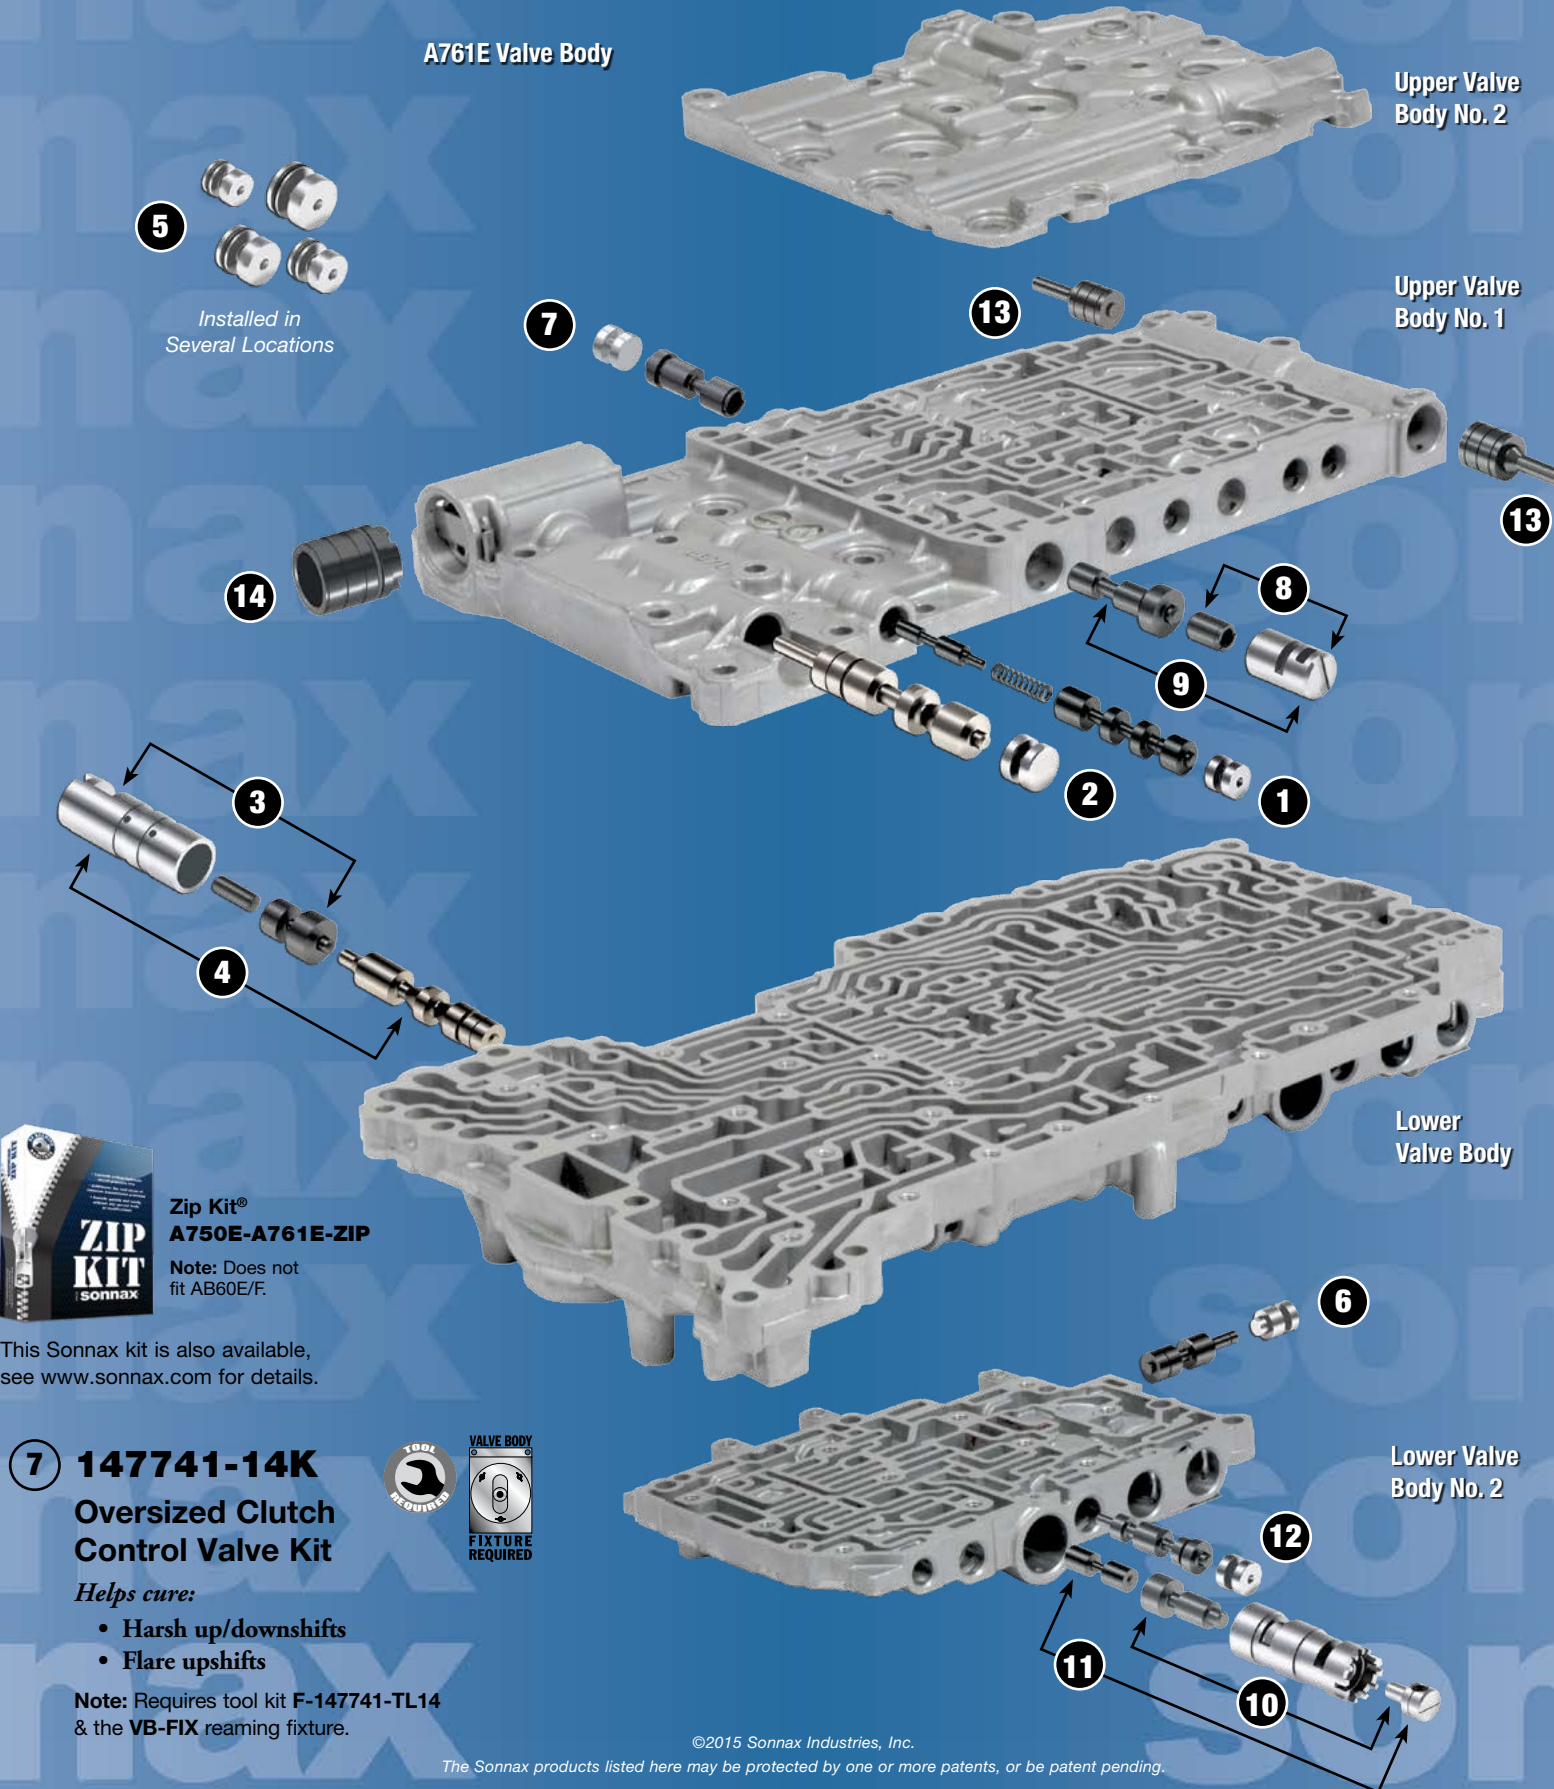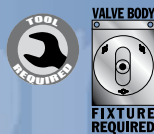

Installed in  
Several Locations



Zip Kit®  
A750E-A761E-ZIP  
Note: Does not  
fit AB60E/F.


This Sonnax kit is also available,  
see www.sonnax.com for details.

## 7 147741-14K Oversized Clutch Control Valve Kit

Helps cure:

- Harsh up/downshifts
- Flare upshifts

Note: Requires tool kit F-147741-TL14  
& the VB-FIX reaming fixture.

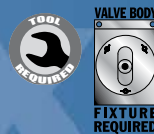

## 8 147741-37K Lockup Control Plunger Valve Kit

(Fits A760E/F/H, A750E/F,  
A761E, A960E/F Only)

## 157740-37K Lockup Control Plunger Valve Kit

(Fits AB60E/F Only)



## 9 147741-16K Oversized Lockup Control Valve Kit

(Fits A760E/F/H,  
A750E/F, A761E, A960E/F Only)

## 157740-16K Oversized Lockup Control Valve Kit

(Fits AB60E/F Only)

Helps cure:

- Harsh downshifts
- RPM surge on coast

Note: 147741-16K Requires tool kit F-147741-TL16;  
157740-16K Requires tool kit F-157740-TL16  
& they both require the VB-FIX reaming fixture.



## 10 147741-35K Accumulator Control Plunger Valve Kit

## 11 147741-24K Oversized Accumulator Control Valve, Plunger Valve Kit

Helps cure:

- Shift complaints & codes
- Harsh shifts

Note: 147741-24K Requires tool kit 147741-TL24.




## 12 147741-28K Oversized Brake Control Valve Kit

Helps cure:

- Shift complaints & codes
- Harsh shifts

Note: Requires tool kit F-147741-TL28 & the VB-FIX reaming fixture.

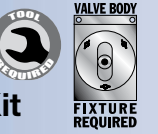


## 13 147741-13 Oversized B2 Accumulator Pistons

Fits 2 locations

Helps cure:

- Harsh or slipping 5-6 shifts
- Harsh 3-2 downshifts

Note: Requires tool kit F-147741-TL13 & the VB-FIX reaming fixture.

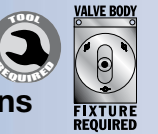

## 14 57917E-19K Accumulator Piston Kit

Helps cure:

- Delayed engagements
- Slips/Flares in Forward gears

Fits U140E/F, U240E, U241E, U150E, U151E/F, U250E, A750E/F, A760E/  
F/H & A761E

©2015 Sonnax Industries, Inc.

The Sonnax products listed here may be protected by one or more patents, or be patent pending.